



SEAT Leon

Sports Tourer (from 2020)





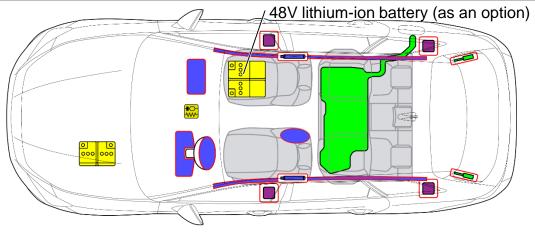

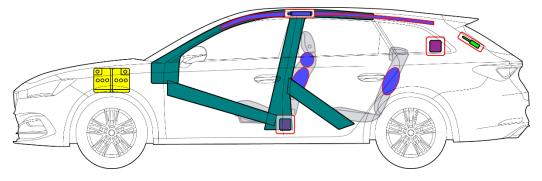

Information: the illustration shows the maximum possible range of equipment.

	Airbag		Gas generator	Belt tensioner	*	SRS control unit		Active pedestrian protection system
9	Automatic rollover support system		Gas strut / pre- tensioned spring	High-strength area		Special attention		
000 000	Low-voltage battery	HH	Low-voltage ultra- condenser	Fuel tank		Gas tank		Safety valve
0 0	High-voltage battery	2	High-voltage cables	High-voltage device to the high- voltage shutdown system		Fuse box Deactivation High-voltage system	4	High-voltage super- condenser

Brand	Туре	Step	Year of market entry	Internal reference	Creation date	Edition	Version no.	Page
SEAT	Leon	1	2020	VSS-KL80K50	15/02/2019	01/12/2020	4	1 of 3



SEAT Leon

Sports Tourer (from 2020)

1. Identification / recognition

Logo





It is possible that no logo is present

2. Immobilisation / stabilisation / lifting


Immobilising the vehicle

Press button "P" (park) and operate handbrake.





Lifting points

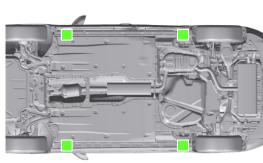

Suitable lifting points

3. Disable direct hazards / safety regulations

Turn the ignition off

Deactivation of the 12-volt vehicle current supply



Open the bonnet


Locate the 12-volt vehicle battery


Disconnect negative battery terminal (-)

Disconnect the 48-volt lithium-ion battery:

Deactivation of the 48-volt vehicle current supply



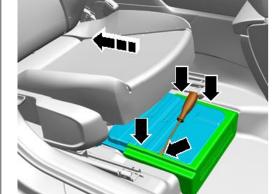

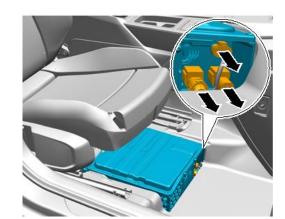

The 48-volt vehicle electrical system is automatically deactivated in accidents involving the triggering of the airbag.


Brand	Туре	Step	Year of market entry	Internal reference	Creation date	Edition	Version no.	Page
SEAT	Leon	1	2020	VSS-KL80K50	15/02/2019	01/12/2020	4	2 of 3



SEAT Leon

Sports Tourer (from 2020)

4. Access to the occupants

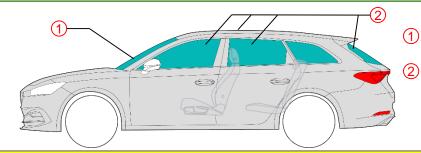

Glazing:

Laminated glass

Single-pane safety glass

5. Stored energy / liquids / gases / solids



6. In case of fire














Lithium-ion batteries may catch fire both spontaneously and after a delay in time due to damage or improper handling. d ir ∭

They may also may re-ignite after the fire has been extinguished.

Wear suitable personal protective equipment!

10. Explanation of pictograms used

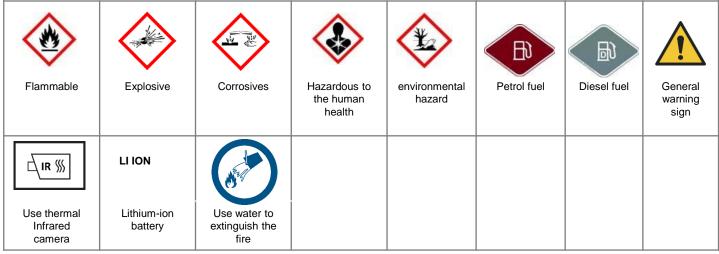

Brand	Туре	Step	Year of market entry	Internal reference	Creation date	Edition	Version no.	Page
SEAT	Leon	1	2020	VSS-KL80K50	15/02/2019	01/12/2020	4	3 of 3